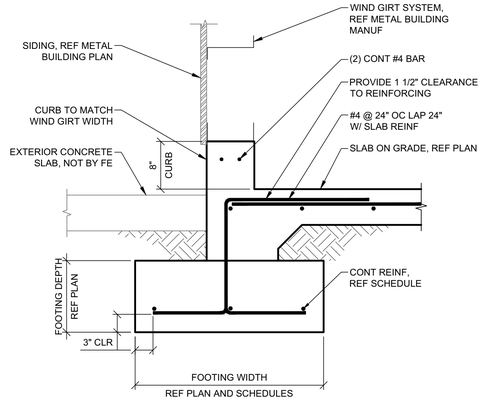

6 S5.1 THICKENED EDGE DETAIL AT DOOR
SCALE: 1" = 1'-0"
16-B251

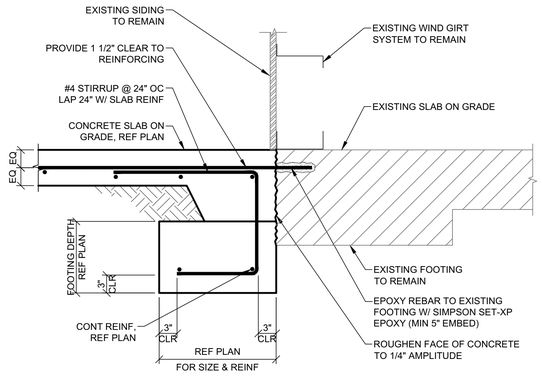

7 S5.1 THICKENED EDGE DETAIL AT DOOR
SCALE: 1" = 1'-0"
16-B251

NOTES:
1) BLOCKOUTS SHALL NOT BE PLACED CLOSER THAN 24"
2) REF MEP FOR PLUMBING PENETRATION LOCATIONS.

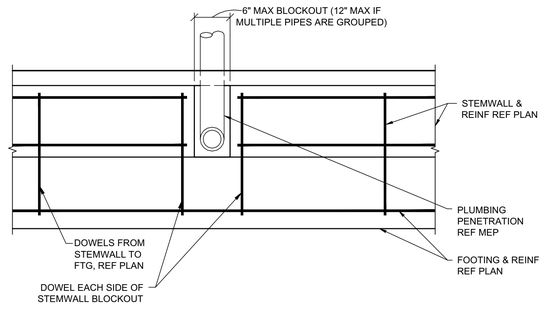

8 S5.1 STEMWALL BLOCKOUT AT PLUMBING PENETRATIONS
SCALE: 1" = 1'-0"
16-B251

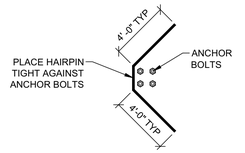

SECTION A-A

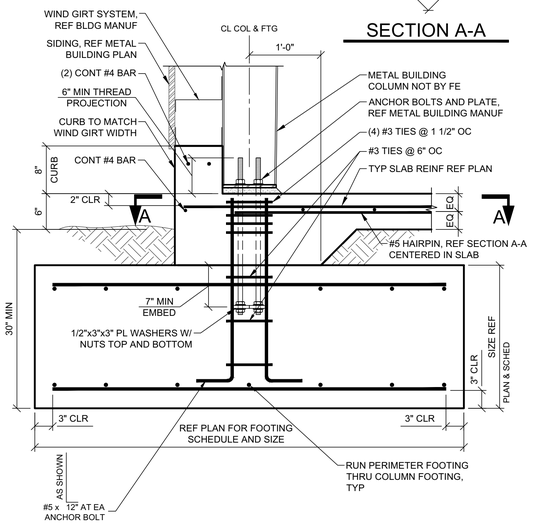

4 S5.1 EXTERIOR COLUMN AT FOOTING DETAIL
SCALE: 1" = 1'-0"
16-B251

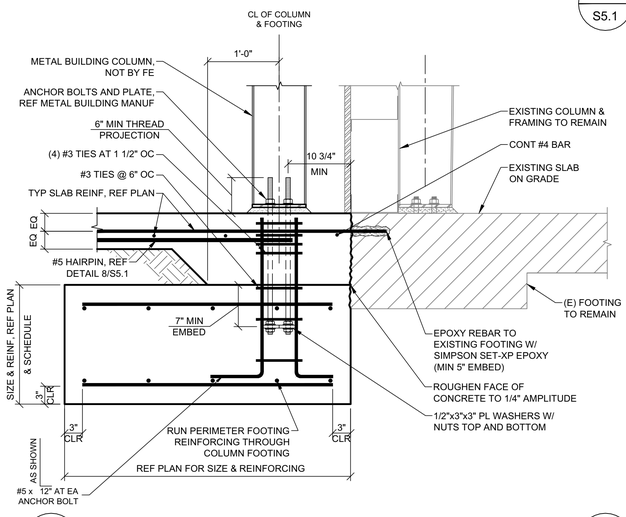

5 S5.1 EXTERIOR COLUMN AT FOOTING DETAIL
SCALE: 1" = 1'-0"
16-B251

NOTES:
CONTRACTOR MAY USE EITHER CONTROL JOINTS OR CONSTRUCTION JOINTS AT LOCATIONS INDICATED ON PLANS

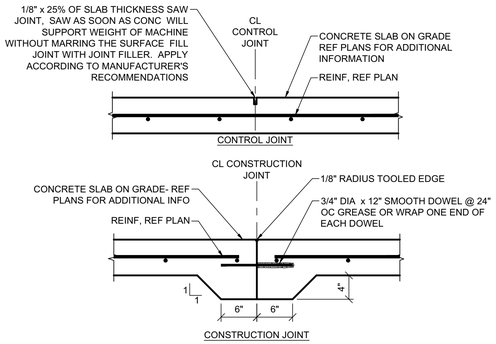

1 S5.1 SLAB JOINTS
SCALE: 1" = 1'-0"
16-B251

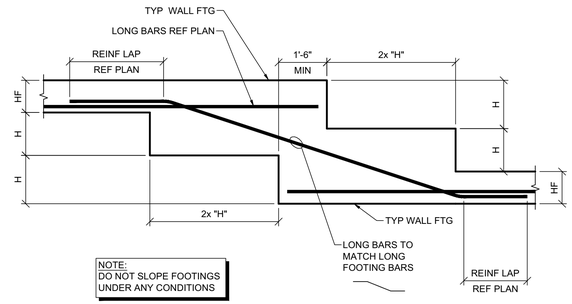

NOTE:
DO NOT SLOPE FOOTINGS UNDER ANY CONDITIONS

2 S5.1 STEPPED FOOTING
SCALE: 1" = 1'-0"
16-B251

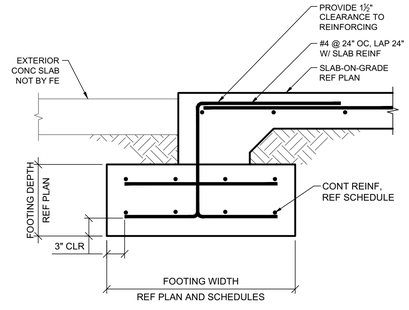

3 S5.1 THICKENED EDGE DETAIL AT DOOR
SCALE: 1" = 1'-0"
16-B251

REVIEWED FOR CODE COMPLIANCE
BP-17-3412-CADD
501 SE 2ND ST
BLDG B

FROELICH ENGINEERS
PORTLAND: (503) 624-7005
BEND: (541) 383-1828
DENVER: (720) 560-2269
froelich-engineers.com
JOB# 16-B251

STAMP
REGISTERED PROFESSIONAL ENGINEER
79228 PE
OREGON
MARCH 11 1005
MICHAEL B. PETERSON
Expiration Date 12/31/18

STEELE ASSOCIATES
ARCHITECTS LLC
686 NW YORK DRIVE #150 BEND, OR 97703
541.382.9867 FAX 541.385.8816 info@steele-arch.com

BLS - TRANSPORTATION FACILITY 2017
501 SE 2ND STREET BEND, OR,

FOUNDATION DETAILS

JOB NO.	16116.01
DATE	7/10/2017
DRAWN BY	CAD-6
CHECKED BY	MP
REVISIONS	DATE
PERMIT SUBMITTAL	07/14/2017

SHEET NO.
S5.1

PERMIT REVIEW SET

7/10/2017 11:09 AM 16116.01 P:\2016\16-B251 (BLS) Maintenance Bldg\Drafting-Structural\CAD\16-B251_SHDP_S5.1.dwg